Datacolor

Datacolor 550 User's Guide



Datacolor 550 User's Guide (Part No. 4230-0391M, April 2005)

All efforts have been made to ensure the accuracy of the information presented in this format. However, should any errors be detected, Datacolor appreciates your efforts to notify us of these oversights.

Changes are periodically made to this information and are incorporated into forthcoming versions. Datacolor reserves the right to make improvements and/or changes in the product(s) and/or program(s) described in this material at any time.

Copyright © 1996-2004 Datacolor. ALL RIGHTS RESERVED. This material may not be reproduced or duplicated, in whole or in part, with the express written permission of Datacolor.

Microsoft®, MS-DOS®, and Microsoft Windows® are registered trademarks of Microsoft Corporation. All other registered trademarks are the property of their respective owners.

To obtain information on local agents, contact either of the offices listed below, or visit our website at <u>www.datacolor.com</u>.

| United State | S | Switzerland | |
|---------------|------------------|-------------|-----------------|
| Lawrenceville | e, NJ | Dietlikon | |
| Telephone: | 1 (609) 924 2189 | Telephone: | (41) 1 835 3711 |
| Fax: | 1 (609) 895 7472 | Fax: | (41) 1 835 3820 |

Contents

| Datacolor 550 | |
|--|----|
| About the Datacolor 550 | 1 |
| Electrical and Environmental Requirements | 2 |
| Adjustable UV Filter Option | 2 |
| Transmission Option | |
| Feature Summary | |
| Accessories | |
| Calibration Tiles | 4 |
| Aperture Plates | 4 |
| Cable Installation | 7 |
| Power Cable | 7 |
| Serial Cable Installation | 8 |
| USB Cable Installation | 8 |
| Cable Installation | 9 |
| Driver Installation | 9 |
| Changing the Instrument Port Setting in Datacolor Programs | 11 |
| Com Port Setting | 11 |
| Installing Calibration Data | 12 |
| Controls and Indicators | 13 |
| Controls and Indicators Panel | 13 |
| Powering Up | |
| Instrument Calibration | |
| Reflectance Calibration | |
| Transmittance Calibration | |
| Transmission Accessories | |
| Sample Presentation and Measurement | |
| Sample Presentation and Measurement Overview | |
| Reflectance Measurements | |
| Sample Viewing Port | |
| Transmittance Measurements | 21 |
| Maintenance | |
| About Instrument Maintenance | |
| Sphere Cleaning | |
| Tile Handling and Cleaning | |
| Appendix | |
| Datacolor 550 Optical Block Diagram | |
| Instrument Specifications | |
| Optional Accessories | |
| Miscellaneous Technical Information | |
| System Requirements for USB Connection | |
| RS-232C Connector Pin Assignments | |
| Compliance Statements | |
| FCC Compliance Statement | |
| Canadian Compliance Statement | |
| | |
| Index | 33 |

Datacolor 550

About the Datacolor 550

The Datacolor 550 is a member of the latest generation of bench top color measuring instruments manufactured by Datacolor, incorporating state-of-the-art CMOS integrated circuit technology in the instrument design. It is intended for use as a device for measuring, specifying and evaluating color in both laboratory and production settings.



Below is a summary of the standard and optional features included with the Datacolor 550.

Standard features include the following:

- Multiple aperture sizes to accommodate samples of different sizes
- Automated, adjustable ultra-violet filters for measuring fluorescent samples
- Transmittance Measurement
- Pulsed xenon light source
- Automated specular port
- Automated zoom lens

Electrical and Environmental Requirements

| Power | 85 to 264 VAC, 47 to 63 Hz, 80 VA peak, 35 VA typical |
|-----------------------------------|--|
| Absolute Operating Environment | 5º to 40º C, 5-85% RH, non-condensing |
| Interfaces | Serial: RS232 9600/115200 baud (shipped at 19200 baud) |
| | USB: 1.1 |

Adjustable UV Filter Option

This option offers the ability to control the amount of UV light emitted from the light source. This is used for applications that need to identify the presence of optical brightening agents, or other types of fluorescent materials in the samples being evaluated.

The configuration of the adjustable UV filter option is handled through the software. See the Datacolor Tools User Guide for detailed instructions to configure the option and calibrate the instrument.

Transmission Option

The 550 can measure the "regular" transmittance of transparent solid and liquid samples.

Safety Warnings

If the equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.

Caution: There are no user-serviceable parts for this equipment.

Light Source

Do not stare directly into the open port located in the front door panel when the measurement is in progress. Staring directly into the light source can result in eye discomfort similar to that of staring at a camera flash.

Power

CAUTION

Disconnect power before servicing.

ID NOTE The power cord supplied with the unit <u>must</u> be used.

Feature Summary

The Datacolor 550 employs state-of-the-art features including the spectrometer, integrating sphere, light source, and optics. Below is a summary of those features:

| FEATURE | DESCRIPTION | PURPOSE/BENEFIT |
|-----------------------------|---|---|
| Integrating sphere | Barium coating sphere. | Industry standard. |
| Measurement Geometry | D/8º geometry, Specular Component Included (SCI) or excluded (SCE). | Provides for more uniform measurement of samples with irregular surfaces. |
| SP2000 Spectral Analyzer | Proprietary dual-channel holographic grating. 256- photodiode linear arrays used for both the reference and sample channels. | Dual channel design provides continuous monitoring of sample illumination and compensates for changes. 256-photodiode array enhances the precision of the measurement. |
| Light source | Pulsed xenon flash lamp | Filtered to provide D65 illumination including UV component. |
| Effective Bandwidth | 10nm | Reporting interval. |


Accessories

All models come with the following standard accessories:

- 3 Aperture Plates
- Black Trap
- White Tile
- Green Tile
- Six foot power cable
- Black Card
- Serial cable with connectors on either end
- USB Cable

Calibration Tiles

A black trap, white tile and green tile are provided with all Datacolor 550 instruments:

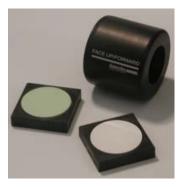

The black trap and white tile are used each time the instrument is calibrated. The green tile is used to perform an optional diagnostic test.

Aperture Plates

Three aperture plates are included as standard accessories with the Datacolor 550. The identification is engraved on each plate.



- Large Area View (LAV)
- Small Area View (SAV)
- Ultra-Small Area View (USAV)

Optional Aperture Plates

• Extra Ultra Small Area View (XUSAV)

Below are aperture plate specifications:

| Aperture Identification | Sample Area Measured | Sample Area Illuminated |
|----------------------------|-------------------------|----------------------------|
| LAV | 26mm | 30mm |
| SAV | 5mm | 9mm |
| USAV | 2.5mm | 6.5mm |
| XUSAV | 2.5mm | 3.0mm |

🔛 ΝΟΤΕ

The area illuminated is always 4mm greater than the diameter measured, to reduce translucency errors. The exception to this is the XUSAV plate.

Tips for Aperture Selection

- Always use the largest possible aperture size.
- The Large Area View (LAV) plate is recommended for averaging samples with irregular surfaces and textured samples.
- Small (SAV) and Ultra-Small Area View (USAV) plates should only be used for measurements of samples that do not completely cover the opening of the larger aperture plates.
- Large Area View (LAV) must be used for transmission measurements.

Cable Installation

You must install a power cable, and either a USB cable **or** a serial cable to connect the instrument to a computer.

Read the "Electrical and Environmental Requirements" section *BEFORE* connecting your Datacolor 550 instrument.

The connections for these cables are found on the back of the instrument.

 
Power Cable

A six-foot power cable is provided with the instrument.



ID NOTE The power cord supplied with the unit <u>must</u> be used.

Power is supplied to the back of the unit via a 3-prong male connector.



Plug the female end of the power cord into the power receptacle on the rear panel of the instrument. Insert the plug into a standard AC outlet.

Serial Cable Installation

The serial cable is shown below:



- 1. Connect the 9-pin male connector on the serial cable to the RS-232C female connector on the rear panel of the instrument.
- 2. Connect the female connector on the serial cable to a serial communications port on the back of the computer.



- 3. If there is more than one serial port on the computer, make a note of the port being used. You may need to enter this information into the program.
- 4. Tighten each connection securely to ensure proper signal.

See the Appendix for a description of the RS-232C connector pin assignments.

USB Cable Installation

The 550 can be connected to a USB port on a desktop system. See Appendix, System Requirements for USB Cable Installation before you attempt to connect to a USB port.

Before You Begin

 
- Close all programs currently running on the system.
- You will need the accessories listed below to complete the installation:
 - USB cable (provided by Datacolor)
 - Datacolor CD ROM disk labeled, "USB Drivers and Documentation" (Datacolor part number 2052-0330).
 - Calibration diskette included with the instrument (this is required only when installing new instruments)

Three steps must be completed to enable the USB port for use with the instrument:

- Install the USB Driver.
- Identify the system assignment for the USB port. This is accessed through the *Control Panel* included with the Windows operating system.
- Change the com port assignment in the Datacolor applications software.

Cable Installation

The USB cable provided with the system is shown below:



One end of the cable connects to a USB port on the instrument. The other connects to a USB port on the computer.

• Connect the USB cable to the instrument and to the USB port on the back of the computer.

Driver Installation

To prepare your computer and the Datacolor programs to communicate with your instrument using a USB port, you must install software files onto the computer. This is done by following a Wizard that will appear on your computer screen when you connect the USB cable to the instrument, and to the USB port on the back of the computer.

- 1. Place the **USB Drivers and Documentation CD** into the CD-Rom drive.
- 2. Connect the USB cable to both the instrument and the computer. The window below will automatically appear:



The New Hardware Wizard window will follow immediately:

| Found New Hardware Wizard | |
|---------------------------|--|
| | Welcome to the Found New Hardware Wizard This wizard helps you install a device driver for a hardware device. |
| | < Back Next > Cancel |

- 3. Click on the *Next* button at the bottom of the window. The wizard will step you through the installation of the USB software files. For most installations, you can accept the defaults selected by the Wizard.
- 4. Continue to click the **Finish** button at the bottom of each window in the Wizard. The program will notify you that the procedure is completed.

| Found New Hardware Wizard | |
|---------------------------|--|
| | Completing the Found New Hardware Wizard USB High Speed Serial Converter |
| | Windows has finished installing the software for this device. |
| | k |
| | To close this wizard, click Finish. |
| | < Back Finish Cancel |

5. Click **Finish**. **Do not remove the USB Driver CD from the system**. The "Found New Hardware Wizard" will automatically appear again, and the process must be repeated a second time to complete the software installation.

D NOTE

During the file installation, the USB port is given a com port assignment. You will need to know the port assignment to configure the Datacolor applications software to recognize the USB port. The port assignment can be viewed and changed using the Systems option included on the Control Panel.

Changing the Instrument Port Setting in Datacolor Programs

To enable the USB port for color measurements, you must change the com port assignment in the applications program. While this procedure varies depending on the particular program, It is typically accessed through an *Instruments Menu*, or *Instrument Setup* icon. Below is an example of the screens that appear in most of the Datacolor programs. If they do not match your program, refer to the program documentation for the individual application program you are running for configuration instructions.

Instrument Type

| 🖪 Single 🛛 🛛 Multiple 🖁 Until Tol. 🖡 | Calibrate 🦞 Instruments Setup 🗗 General Options |
|--------------------------------------|--|
| Instrument type: | CE7000A : ColorEye 7000A |
| | MF200D : DCI Microflash 200d MF45 : DCI Microflash 45 MF454R: DCI Microflash 45 IR MS2025 : Macbeth 2025 SF300 : DCI Spectraflash 300 SF300UV: DCI Spectraflash 300v SF450 : DCI Spectraflash 450 SF450 : DCI Spectraflash 450 SF450 : Sci Spectraflash 500 SF600 : DCI Spectraflash 600 SF600 : DCI Spectraflash 600× Sf000 : DCI Spectraflash 600× Sf000 : DCI Spectraflash 200×++ |

- If you are installing a new instrument, you need to select the correct instrument type. Click on the down arrow, and scroll through the instrument listing to find the instrument you are using.
- If you are connecting an existing instrument to a USB port, this selection does *not* need to be changed.

Com Port Setting

To complete the USB configuration for the instrument, you must assign the correct communications port (com port) setting to the instrument. While this procedure varies depending on the particular Datacolor applications program, It is typically accessed through an *Instruments Menu*, or *Instrument Setup icon*.

Below is an example of an *Instrument Setup* screen you may see in the Datacolor program you are running. However, you should also refer to the program documentation specific to the Datacolor program you are running for instructions regarding this port assignment.

| | Communication parameters | Com1:19200,N, 8,2 | | |
|-----------------|--------------------------|-------------------|------------|--|
| $\left \right $ | Communication port: | Com1 🔽 | | |
| | Bits per Seconds | Com1 Advanced | | |
| | Data bits: | Com3 | | |
| | Parity bit: | N | | |
| | Stop bit: | 2 | | |
| | Serial Number | 7165 | | |
| | | | | |
| | | | Save Setup | |
| | Stop bit: | 2 | Save Setup | |

- 1. In the *Communication port* field, select the COM port assigned to the USB port. (This port assignment must match the assignment in the Windows Control Panel.)
- 2. Click on the down arrow, and highlight the COM port that has been assigned to the USB port.
- 3. When the changes are completed, click **Save Setup**.

Installing Calibration Data

If this is a new instrument, you will need to load the calibration data.

1. When you complete the instrument configuration and select *Save Setup*, the program prompts you to place the diskette containing the calibration data into the diskette drive. When you do this, a screen similar to the one below will appear:

| Loading the A | bsolute White Values: |
|----------------|-------------------------------------|
| Look in: 🛃 | 3½ Floppy (A:) 💽 🔶 💼 🕈 🏢 🗸 |
| WHITESE | Type: DAT File Size: 299 bytes |
| File name: | "WHITESI.DAT" "WHITESE.DAT" Open |
| Files of type: | Abs.white Value Files (whites?.dat) |
| | Open as read-only |

 You must load <u>both</u> files. Highlight both file names, and click **Open**. The files will be transferred to the desktop system. When the transfer is completed, the calibration screen will appear.

| Calibration conditions | | | |
|--|-----------|---|--------------------------|
| Specular C Include C Exclude C Gloss Aperture | sf600+ | UV-Filter • 100 % UV (Filter off) • 0 % UV (Filter FL40) • Filter FL42 • Filter FL46 | Calibrate |
| Large Medium Small Ultra Small Extra Ultra Small | | UV Ganz-Griesser Calibration UV GIE Whiteness D65/10 UV GIE Whiteness C/2 Calibrator % remaining part of UV UV-Excl.filters options | Abs.white Gloss table |
| Auto-Zoom | (hours) · | Transmittance | |
| Calibration condition: Calibration time: | | | |

3. Click **Calibrate** to start the instrument calibration or **Cancel** to close the window.

See the program documentation for instructions to calibrate the instrument.

Controls and Indicators

Controls and Indicators Panel

A status panel is located on the top of the instrument. It identifies the current instrument settings being used.



Below is the status panel for the Datacolor 550:



Ready. Instrument is ready for use.

Spec Exc. The specular port is open and all measurements exclude the specular reflection from the sample.

Spec Inc. The specular port is closed, and all measurements include the specular reflection from the sample.

Powering Up

Use this simple procedure to start using your Datacolor 550.

- 1. Verify all cable connections. The AC power cord should be plugged into an outlet. The communications cable (serial or USB) should be attached to the instrument and host computer.
- 2. Turn on the host computer.
- 3. Turn on the instrument power switch. This is located on the lower right side of your instrument toward the front.



- When power is applied, all mechanisms are automatically reset.
- The red lights on the status panel will flash briefly.

D NOTE

If the instrument power is not turned on before a Datacolor program is launched, you may receive an error message.

When the **Ready** light remains on, your instrument is ready to use.

- 4. Launch a Datacolor program.
- 5. Prepare to calibrate the instrument. You will need the black trap, the white calibration tile and the green diagnostic tile.

🔛 ΝΟΤΕ

We recommend that you calibrate the instrument every 8 hours. *Please refer to your software documentation for specific calibration instructions.*

Instrument Calibration

Reflectance Calibration

The instrument should be calibrated every 8 hours to compensate for changes in the environment. A black trap, white tile and green tile are provided with all Datacolor instruments to complete the calibration:



The black trap and white tile are used each time the instrument is calibrated. The green tile is used to perform an optional diagnostic test. If you are using an instrument with an adjustable UV filter, a fluorescent calibration standard will also be included.

The software prompts for calibration vary from one program to another. All of the procedures include a measurement of:

- The black trap
- The white tile

The Datacolor Tools User Guide provides step-by-step instructions regarding the software setup and instrument calibration procedure for reflectance measurements.

🔛 NOTES

The Datacolor Tools User Guide contains step-by-step instructions for calibrating the adjustable UV filter.


Transmittance Calibration

The Datacolor 550 includes an option to measure the *regular* transmittance of samples. When working with samples that are completely transparent (such as dyes in solution or transparent plastics) you are measuring *regular* transmittance. The transmission compartment of the Datacolor 550 is large enough so that the colorist can easily insert and remove samples.

Transmission Accessories

The following accessories are used for transmission measurements:


- Black Calibration Card. Included with the standard instrument accessories. It is used to perform the zero (black) calibration when calibrating the instrument for transmission.
- White Tile. Placed at the sample port for calibration and measurement.

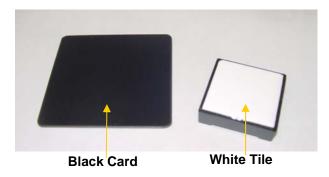

• **Transmission Sample Holder**. This is an optional accessory that can be ordered from Datacolor. It is designed for measuring the transmittance of either solid or liquid samples.


🔛 ΝΟΤΕ

The transmission sample holder is designed to hold a cuvette 50mm X 10mm (Datacolor Part No. 2950-0004).

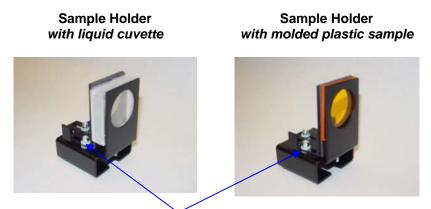

 Thumb screws provide the ability to adapt the holder to samples of varying thickness. • The sample holder is mounted onto the transmission sample holder base

Transmission Sample Holder Base

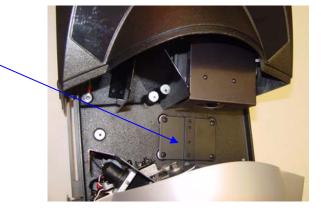

It is held in place by a magnet in the base of the holder.

Keep the transmission sample holder away from any magnetic media. The magnet in the base of the holder can corrupt data stored on diskettes and other types of magnetic media.



Calibration Procedure

Before you begin, you should verify the current aperture selection. The setting should be Large Area View (LAV) and the LAV plate should be placed at the instrument port.

🔛 ΝΟΤΕ

All transmission calibration and measurements can only be made using the Large Area View aperture selection.

The instrument can be calibrated with the transmission sample holder in the chamber. To calibrate the instrument for transmittance measurements, do the following:

- 1. Open the transmission compartment and make sure the optical path between the sphere and the lens is clear.
- 2. Access the calibration procedure in the program you are running.
- 3. When you are prompted by the program, block the lens using the black card:



- 4. When the measurement is completed, remove the black card from the transmission compartment.
- 5. Place the white tile at the sample port, and make the next calibration measurement.



NOTES The white tile remains at the port for all subsequent measurements.

Make sure the sphere opening/lens opening is completely covered by the sample you are going to measure.

Sample Presentation and Measurement

Sample Presentation and Measurement Overview

You must pay close attention to the positioning of the sample to insure an accurate measurement. When positioned correctly, the sample rests between the sample holder and the front panel door. The sample must completely cover the aperture opening.

Reflectance Measurements

- 1. Grasp the sample holder and pull forward.
- 2. Position the sample, then carefully bring arm back up to normal operating position.



A WARNING Do not allow sample arm to spring back.

Sample Viewing Port

When measuring the reflectance of small samples, you may need to check that the sample is properly positioned at the port. To verify that the correct area of the sample is being measured:

1. Grasp the black tab above the aperture plate.



2. Pull top of door down to its full horizontal position.



3. The backside of this door reveals the area of the sample covering the port opening. If necessary, adjust the placement of the sample to target the portion of the sample to be measured.



4. Push the door back to its normal position.

Transmittance Measurements

When working with samples that are completely transparent (such as dyes in solution or transparent plastics) you are measuring "regular" transmittance. These samples need to be positioned close to the lens opening at the back of the transmission compartment:

To measure the regular transmittance of a transparent sample, do the following:

- 1. Verify that the instrument setup selected in the program is transmission.
- 2. Calibrate the instrument for transmission. When the calibration is completed, leave the white tile at the port.
- 3. Open the chamber and position the sample as close to the lens as possible:



Lens Opening

Regular transmittance measurements are made with the white plaque at the port.



4. Start the measurement. When completed, remove the sample from the chamber.

NOTES

Maintenance

About Instrument Maintenance

The sections that follow provide detailed instructions for maintaining the instrument and calibration tiles. These instructions and tips will help to insure that the instrument continues to perform properly over its life.

Sphere Cleaning

The sphere should be examined visually for the presence of dust, sample particles, fibers, and excessive yellowing due to environmental influences. *This inspection should be performed frequently, especially if you measure loose materials.*

If you discover loose materials in the sphere, they should be removed. An optional accessory, the Minivac portable cleaning system is a useful tool for cleaning the sphere.



Operating the Minivac Portable Cleaning System

- 1. Configure the instrument so that the specular port is closed (**S**pecular **C**omponent Included).
- 2. Remove the aperture plate from the front of the unit.



3. Look inside the sphere.

4. Using the Minivac portable cleaning system, carefully vacuum away any loose materials in the sphere.



Do not touch the inside of the sphere. The coating is very fragile.

5. When finished, replace the aperture plate.

Tile Handling and Cleaning

Handling Tiles

- Handle calibration tiles with **extreme care.** Do not drop them, or scratch the glazed surface.
- Always grasp the tile using its edges.

Cleaning Tiles

• The calibration tiles should be cleaned before each use. Wiping clean with a soft, lint-free cloth can do this.



- A detergent, free of optical brighteners, fluorescent materials or photoactive dyes should be used as needed to clear any oils, fingerprints, or other deposits. Liquid dish detergent is a suitable detergent. The detergent/water solution should be prepared as follows: 1 part detergent : 250 parts water. Use a few drops of the detergent solution to moisten a soft, lint-free cloth, and gently wipe the tile surface. Rinse the detergent from the tile by wiping it with a cloth, moistened with clean water.
- **NEVER** use abrasive cleansers, razor blades, or other metal objects to remove dirt or foreign substances from the calibration tiles. This will damage the tile surface.
- **NEVER** immerse the tiles in water.
- Tiles that have scratches, chips, abrasions or cracks must be replaced. Signs of wear on the tile surface will affect the accuracy of the calibration.

Storage

- Large temperature variations will affect the accuracy of your calibration, requiring more frequent calibration. The calibration tiles should be stored in an environment that simulates the temperature of the samples to be measured.
- Prolonged exposure to sunlight or other sources of ultra-violet radiation will cause the color of the tiles to change. The tiles should always be stored in a protective case or container away from direct sunlight and environmental contaminants.

Cleaning the Black Trap


The black trap should be kept dust-free. Dust accumulating in the black trap should be blown out with compressed air.



NOTES

Appendix

Datacolor 550 Optical Block Diagram

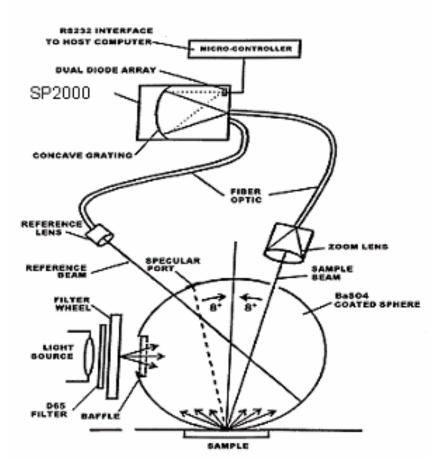

Instrument Specifications

| ITEM | DESCRIPTIC | N |
|--|---|--|
| Instrument Type | Dual beam | integrating sphere with xenon flash lamp. |
| Measuring Geometry | | nination, 8º viewing in conformance with CIE No. 15.2 Colorimetry. |
| Illumination Source | Pulsed xend | on, filtered to approximate D65. |
| Spectral Analyzer | | SP 2000 analyzer with dual 256-diode array solution holographic grating. |
| Wavelength Range | 360 – 700nr | n |
| Effective Bandwidth | 10nm | |
| Photometric Range | 0 to 200% | |
| Aperture Configuration | | View. 30mm illuminated/ 26mm viewed |
| | Ultra-Small viewed | View. 9mm illuminated/ 5mm viewed Area View. 6.5mm illuminated/ 2.5mm all Area View*. 3mm illuminated/ 2.5mm |
| Power Requirements | Ultra-Small viewed X-Ultra Sma viewed | Area View. 6.5mm illuminated/ 2.5mm |
| Power Requirements Absolute Operating Environment | Ultra-Small viewed X-Ultra Sma viewed 85 to 264 V | Area View. 6.5mm illuminated/ 2.5mm all Area View*. 3mm illuminated/ 2.5mm |
| Absolute Operating | Ultra-Small viewed X-Ultra Sma viewed 85 to 264 V 5° to 40° C, | Area View. 6.5mm illuminated/ 2.5mm all Area View*. 3mm illuminated/ 2.5mm AC, 47 to 63 Hz, 80 VA peak, 35 VA typical |
| Absolute Operating Environment | Ultra-Small viewed X-Ultra Sma viewed 85 to 264 V 5° to 40° C, Serial: RS23 | Area View. 6.5mm illuminated/ 2.5mm all Area View*. 3mm illuminated/ 2.5mm AC, 47 to 63 Hz, 80 VA peak, 35 VA typical 5-85% RH, non-condensing |
| Absolute Operating Environment Interface | Ultra-Small viewed X-Ultra Sma viewed 85 to 264 V 5° to 40° C, Serial: RS23 USB: 1.1 | Area View. 6.5mm illuminated/ 2.5mm all Area View*. 3mm illuminated/ 2.5mm AC, 47 to 63 Hz, 80 VA peak, 35 VA typical 5-85% RH, non-condensing 32, 9600/115200 baud (shipped as 19200) |
| Absolute Operating Environment Interface Dimensions** | Ultra-Small viewed X-Ultra Sma viewed 85 to 264 V 5° to 40° C, Serial: RS23 USB: 1.1 English | Area View. 6.5mm illuminated/ 2.5mm all Area View*. 3mm illuminated/ 2.5mm AC, 47 to 63 Hz, 80 VA peak, 35 VA typical 5-85% RH, non-condensing 32, 9600/115200 baud (shipped as 19200) Metric |
| Absolute Operating Environment Interface Dimensions** Height | Ultra-Small viewed X-Ultra Sma viewed 85 to 264 V 5° to 40° C, Serial: RS23 USB: 1.1 English 12.8" | Area View. 6.5mm illuminated/ 2.5mm all Area View*. 3mm illuminated/ 2.5mm AC, 47 to 63 Hz, 80 VA peak, 35 VA typical 5-85% RH, non-condensing 32, 9600/115200 baud (shipped as 19200) Metric 32.5cm |

Specifications are subject to change without notice.

* Sample translucency may affect inter-lens agreement

Optional Accessories

Below is a list of the optional accessories:

| Name | Datacolor Part # | Description |
|-------------------------------------|---------------------|---|
| Minivac Portable Cleaning System | 5400-0036 | Used to clean dirt and dust from the integrating sphere of the instrument. |
| Compression Sample Holder | 1035-0191 | Sample presentation device used to measure loose powder, granulated materials, etc. |
| Textile Skein Holder | 1035-0004 | Used to achieve consistent measurements of yarn skeins. |
| Textile Sample Holder-LAV | 1035-0188 | Used to achieve consistent measurement of textile samples |
| Textile Sample Holder-SAV | 1035-0189 | Used to achieve consistent measurement of textile samples. |
| Textile Sample HolderUSAV | 1035-0190 | Used to achieve consistent measurement of textile samples. |
| Carpet Tube Holder—LAV | 1035-0185 | Used to achieve consistent measurement of carpet samples. |
| Transmission Cell Holder | 1035-0183 | Used to measure the transmission of transparent samples, both liquids and solids. |
| Transmission Cell (10mm) | 2950-0004 | Cell used with transmission sample holder to measure liquid samples. |
| Transmission Flow Cell Package | 1035-0184 | Device used to measure the transmission of liquid materials inprocess. |

Miscellaneous Technical Information

System Requirements for USB Connection

Below are the software and firmware versions required to successfully connect a Datacolor instrument to a USB port.

| Operating Systems | Windows 2000, Windows XP Pro |
|---------------------------------------|---|
| USB Firmware | 1.0, 2.0 |
| Datacolor Applications Programs | All support USB. However, if you have purchased a Datacolor 550 to replace an instrument on an existing system, you may need to update the instrument driver. Contact Datacolor to obtain this software update. |

RS-232C Connector Pin Assignments

| <u> Pin #</u> | Purpose | Direction | |
|---------------|---------------|------------------|--|
| 2 | Transmit data | Out (to host) | |
| 3 | Receive data | In (from host) | |
| 7 | Signal ground | | |

CAUTION

(1) DO NOT WIRE to pins other than 2, 3, and 7.

(2) For all unused inputs, the default is active high.

Compliance Statements

FCC Compliance Statement

A WARNING

Changes or modifications to this unit not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.

This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with this User's manual, may cause harmful interference to radio communications.

Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his/her own expense.

This device complies with Part 15 of the FCC Rules. Operation is subject to the following conditions: (1) this device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

Canadian Compliance Statement

English

This digital apparatus does not exceed the Class A limits for radio noise emissions from digital apparatus set out in the Radio Interference Regulations of the Canadian Department of Communications.

Francais

El present appareil numerique n'emet pas de bruits radioelectriques depassant les limites applicables aux appareils numeriques de la class A prescrites dans le Reglement sur le brouillage radioelectrique edicte par le ministere des Communications du Canada. NOTES

Index

Α

Absolute Operating Environment, 28 Accessories, 3, 4 Adjustable UV Filter Option, 2 Aperture *Configuration, 28 opening, 19 Optional Plates, 5* Aperture Selection, 5

В

Black Trap, 3, 4, 15 *Cleaning, 25*

С

Cable Installation, 7, 9 Calibration diskette, 8 Calibration Tiles, 4 Cleaning Tiles, 24 Com Port Setting, 11 Compliance Statements, 31 Controls, 13

D

Driver Installation, 9

Ε

Effective Bandwidth, 3, 28 Electrical Requirements, 2 Environmental Requirements, 2

F

Feature Summary, 3

G

н

Green Tile, 3, 4

Handling Tiles, 24

Illumination Source, 28 Indicators, 13 Instrument Cable Connection, 7 Calibration, 15 Maintenance, 23 Port Setting, 11 Type, 28 Integrating sphere, 3 Interface, 28

L

I

Light source, 3

Μ

Measurement Geometry, 3 Measuring Geometry, 28 Minivac, 23, 29 Miscellaneous Technical Information, 30

0

Optical Block Diagram, 27 Optional Accessories, 29

Ρ

Photometric Range, 28 power cable, 3 Power Cable, 7 Powering Up, 14

R

Reflectance Calibration, 15 Reflectance Measurements, 19 RS-232C Connector Pin Assignments, 30

S

Sample Measurement, 19 Sample Presentation, 19 Sample Viewing Port, 20 Serial cable, 3 Serial Cable Installation, 8 SP2000 Spectral Analyzer, 3 Spectral Analyzer, 28 Sphere *Cleaning, 23* Storage, 25

Т

Transmission Accessories, 16

Transmission Option, 2 Transmittance calibration, 16 calibration procedure, 17 measurements, 21

U

USB cable, 3, 8 cable installation, 8 connection, 30

W

Wavelength Range, 28 White Tile, 3, 4, 15